

USDA-FOREST SERVICE

Index File No. J-23

T 5S R. 33E

Merid. Willamette

**CORNER RECORD (SEARCH)**

(Ref. FSM 7151.4)

Tract or Survey No. \_\_\_\_\_

Cor. No. 1/4

R.D. Ukiah

County Umatilla

State Oregon

N.F. Umatilla

State Oregon

State Oregon

**CORNER DIAGRAM**

S12



S13

**DESCRIBE CORNER MONUMENT FOUND**

Found 16"x10"x5" stone 6" in ground with faint "1/4" on North face under debris from dead trees.

**DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND**

Found down-dead 14" Tamarack with visible scribing "1/4 S BT". This BT has been down for a considerable time and its previous location is difficult to determine. Found large depression and traces of fir roots at location of possible North BT.

**PHOTO IDENTIFICATION DATA**

Photo No. \_\_\_\_\_

Filed At. \_\_\_\_\_

Object Ident. \_\_\_\_\_

Ident. By \_\_\_\_\_

*Signature*

**PLANE COORDINATE POSITION DATA**

State \_\_\_\_\_ Zone \_\_\_\_\_

X \_\_\_\_\_

Y \_\_\_\_\_

Estab. By \_\_\_\_\_

*Agency*

*Signature*

*Howard R. [Signature]*

Title \_\_\_\_\_

Division ORLS

Headquarters 1294

Date 9/77


7100-52-(3/68)

**CORNER RECORD (PERPETUATION)**

**MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT**

In place of stone set 2 1/2"x30" galvanized pipe with brass cap stamped:

T5S R33E  
S12



S13

1980

OR PLS 1294

9

Set pipe 23" in ground with mound of stone to cap and original stone buried alongside.

**ACCESSORIES: DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE**

New Bearing Trees:

A P. Pine 12" dia bears S56°W, 38.0 ft., scribed 1/4 S13 BT.

A Juniper 11" dia. bears N66°E, 34.4 ft., scribed 1/4 S12 BT.

Attached 54-3 & 54-4 signs to all BTs. Attached brass washer stamped LS1294 to foot blaze of new BTs. Painted blazes and 6" band around all BTs Red. Attached 54-4 sign to metal post 5 ft. south of corner

10

Work Done By: R. C. Orton Title Party Chief Date 7-2-80 State Registration No. or Agency \_\_\_\_\_

Certified Cor. Record Prepared? Yes  No  Filed At: \_\_\_\_\_ Date \_\_\_\_\_

11

**REMARKS**

Witnesses: R. Orton  
D. Allen  
L. Huntsman

Index File No. J-23 T. 5S R. 33E M. \_\_\_\_\_ Tract or Surv. No. \_\_\_\_\_ U.S. G.P.O. 1977-725-576/586 Cor. 13

Index  
File No. J-23


**CORNER RECORD (SEARCH)**

(Ref. FSM 7151.4)

Tract of \_\_\_\_\_  
Survey No. \_\_\_\_\_  
Cor. No. \_\_\_\_\_

T 5S R. 33E R.D. Ukiah County Umatilla  
Merid. Willamette N.F. Umatilla State Oregon

**CORNER DIAGRAM**

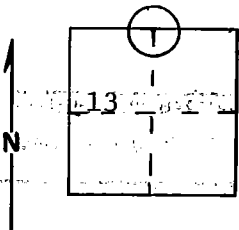

**DESCRIBE CORNER MONUMENT FOUND**

MATERIAL: None

**DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND**

14" ponderosa pine with Forest Service location poster on west face. SW 10' from other is down Tamarack. Bearing tree with upper blaze closed, B.T. in lower blaze. Cannot determine where tree come from. No evidence of stone or North B.T.

**PHOTO IDENTIFICATION DATA**

Photo No. \_\_\_\_\_  
Filed At. \_\_\_\_\_  
Object Ident. \_\_\_\_\_  
Ident. By \_\_\_\_\_  
*Signature*

**PLANE COORDINATE POSITION DATA**

State \_\_\_\_\_ Zone \_\_\_\_\_  
X \_\_\_\_\_  
Y \_\_\_\_\_  
Estab. By \_\_\_\_\_  
*Agency*

Signature

B. Moore

Title

Engineering Technician

Division

Headquarters

Date

5-4-76

7100-52-(3/68)

## CORNER RECORD (PERPETUATION)

---

 MONUMENT : DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT
 

---



---

 ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE
 

---

I placed blank Forest Service bearing tree poster on the down Tamarack.

---

Work Done By _____	Title _____	Date _____	State Registration No. or Agency _____	10
Certified Cor. Record Prepared ?	Yes    No	Filed At: _____	Date _____	11

## REMARKS

---

Index File No.	T.	R.	M.	Tract or Surv. No.	Cor.	12
----------------	----	----	----	--------------------	------	----

---