

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 03/06/08

CORNER DESIGNATION: R-15, The North One-Quarter Corner of Section 27, Township 6 North, Range 36 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Odell & Lewis under GLO Contract No. 110, dated February 7, 1865. Notes state: Set 1/4 Sec. post. Drove charred stake; dug pits & raised mound, as per instructions.

MONUMENT AND ACCESSORIES FOUND: None. Fall in old field line between wheat fields.

MONUMENT MARKING DETAIL:

T6N R36E

1 S22

4 S27

2008

PLS 1106

MONUMENT SET: Corner point was reestablished on line between the accepted Southwest and Southeast Corners of Section 22, holding old field line and fence for departure. At the reestablished corner point, set a 2 3/8" brass cap on a 1 1/4" x 30" galvanized iron pipe, with cap buried 18" below ground level, marked as shown in "Monument Marking Detail".

New accessories:

A silver deep-1 magnet bears North 12 1/2° East, 25.6 feet.

A silver deep-1 magnet bears North 43 1/2° East, 35.2 feet.

A purple deep-1 magnet bears South 59° East, 36.5 feet.

A purple deep-1 magnet bears South 12 1/2° East, 25.9 feet.

All deep-1 magnets are buried 24" below ground level with bearing object signs.

Placed a railroad spike beside the new monument as a memorial.

LOCATION AND COMMENTS:

Corner falls on top of field berm with 3 foot drop to lower field, just West of an old buried woven wire fence. Corner located approximately 600 feet North of Birch Creek Road.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 849810.89

E = 8761707.31

FIRM: Wells Surveying

P.O. Box 1696

Pendleton, OR 97801

COMPASS DECLINATION: 18° East


Surveyor's Seal

Witnesses: Jason Wells, LSIT

6N36R15



William R. Wells

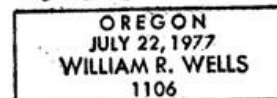

Renews 6-30-10

09-10-C