

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 06/11/2014

CORNER DESIGNATION: K-17, Closing Corner for Sections 15 and 14, Township 6 North, Range 37E, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:

Originally surveyed by A. H. Simmons for US Deputy Surveyor George Williams under his contract No. 176 dated July 20, 1872. The official notes state "set 6 x 17 x 18 rock."

BLM Cadastral Surveyor C. Albert White in 1965 in his notes stated that the point for the closing corner of Sections 14 and 15, at proportionate distance; there is no remaining evidence of the original corner. Set a stainless steel post 28" long 2½" diam., 24" in the ground, with a brass cap marked S15 and S14, R 37E, T6N, CC from which a 20" in diam. cottonwood, bears S. 14°E., 150 links distance marked T6N R37E S14 CC BT.

A fir, 18" in diam. bears S. 13°W, 158 links distance, marked T6N R37E S15 CC, BT.

MOUNUMENT AND ACCESSORIES FOUND:

Found a 3½" BLM brass cap on a 2½" inch iron pipe +/- .59" from ground, +/- 1" south of barbed wire fence. Point is on a steep south facing grassy slope. A creek running east/west bears S. 45° W. at approximately 40 ft.

A 30" diam. Cottonwood tree, with healed blaze, bears S 14° E., 99 ft., we painted and a bearing tag was added to the tree. Please note the tree is in the creek bottom.

A 24" diam. fir tree, with a healed blaze, bears S 13° W., 104.3 ft., we painted and added a bearing tag to the tree. Note: Tree is across the creek bottom on North facing slope.

MOUNUMENT MARKING DETAIL:

WASHINGTON
S15 | S14
OREGON
T6N CC R37E
1965

MOUNUMENT AND ACCESSORIES SET:

A 10" diam. Cottonwood tree, bears S 44° W., 39.94 ft. marked T6N R37E S15 CC BT. Painted, blazed and added a 6" band around the tree, and attached a bearing tree sign.

Set a 5/8" iron rebar at the base of a steel "T" post on East-West fence line painted with a bearing sign attached, bears N 71° E., 53.26 ft.

LOCATION AND COMMENTS:

Bearings taken with Silva hand compass and distances measured with a steel tape.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 859497.06

E = 8795973.20


COMPASS DECLINATION: 15° East

SURVEYORS' SEAL:

FIRM: HDJ Design Group
5 N. Colville, Suite 200
Walla Walla WA 99362

WITNESSES: Thomas J. Boshart
Felipe G. Hernandez

REGISTERED
PROFESSIONAL
LAND SURVEYOR

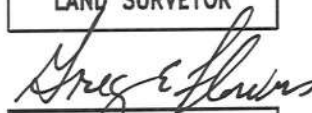

OREGON
JUNE 30, 1997
GREG E. FLOWERS
02820LS

RENEWS 12/31/15

06/29/2015