

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla **DATE:** 01/20/2015

CORNER DESIGNATION: K-5, Closing Corner for Sections 17 and 18, Township 6 North, Range 37E, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:

Originally surveyed by A.H. Simmons for Deputy Surveyor George Williams under his contract No. 176 dated October 23, 1872; his notes state "Set stone 8" x 8" x 12" for Cor. to fractional section 17 and 18.

MOUNUMENT AND ACCESSORIES FOUND:

No evidence found.

MOUNUMENT MARKING DETAIL:

LS 02820
T 6N R 37E
S 18 CC
S 18 | S 17
T 6N R 37E
1/2015

MOUNUMENT AND ACCESSORIES SET:

At the surveyed position set a 2½" brass cap on a 1½" x 30" galvanized iron pipe, 20" deep below the surface of a plowed field from which:

An orange "DEEP-1" magnet and bearing sign buried 20" bears N. 39° W., 15.00 ft.

A silver "DEEP-1" magnet and bearing sign buried 20" bears N. 44° E., 11.50 ft.

A pink "DEEP-1" magnet and bearing sign buried 20" bears S. 41° E., 10.00 ft.

A blue "DEEP-1" magnet and bearing sign buried 20" bears S. 46° W., 10.00 ft.

LOCATION AND COMMENTS:

Bearings taken with Silva hand compass and distances measured with a steel tape.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 859058.06



E = 8780082.38

COMPASS DECLINATION: 15° East

SURVEYORS' SEAL:

FIRM: HDJ Design Group
5 N. Colville, Suite 200
Walla Walla WA 99362

WITNESSES: Joseph R. Latimer
Corey A. West

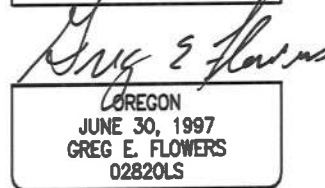

RENEWS 12/31/15

6/29/2015