

**OREGON CORNER RESTORATION FORM**

**COUNTY:** Umatilla    **DATE:** 2/06/2015

**CORNER DESIGNATION:** R-15, Section Quarter Corner common to Sections 22, and 27  
Township 6 North, Range 37 East, W.M.

**PREVIOUS RENEWALS/SURVEYS ETC:**

Originally surveyed by George Williams, Contract No. 176, dated July 20, 1872. His notes state  
"Set post + stone 18 x 18 x 36 mound of stone for quarter section, with bush S. side of mound.

**MOUNUMENT AND ACCESSORIES FOUND:**

No evidence found.

**MOUNUMENT MARKING DETAIL:**

	LS 02820	
	T6N	R
¼	<u>S22</u>	3
	S27	7
	2015	E

**MOUNUMENT AND ACCESSORIES SET:**

At the surveyed position, set a 2½" brass cap on 1½" x 30" galvanized iron pipe, set 14" above ground surface with rock mound around said monument with the following accessories:

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears N22°W, 35.00 feet distance.

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears N80°E, 9.40 feet distance.

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears S51°E, 12.00 feet distance.

A 5/8" x 30" iron rebar with yellow plastic cap "TLS-HDJ" bears S80°W, 31.20 feet distance.

**LOCATION AND COMMENTS:**

Bearings taken with Silva hand compass and distances measured with a steel tape.

**OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:**


N = 850987.42  
E = 8793180.19

**COMPASS DECLINATION:** 15° East

**SURVEYORS' SEAL:**

**FIRM:** HDJ Design Group  
5 N. Colville, Suite 200  
Walla Walla WA 99362

**WITNESSES:** Joseph R. Latimer  
Cory A. West

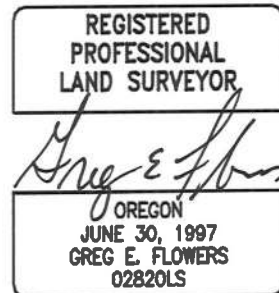

RENEWS 12/31/15

06/29/2015