

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 853917.57

E = 8806237.63

COMPASS DECLINATION: 15° East


SURVEYORS' SEAL:

FIRM: HDJ Design Group
5 N. Colville, Suite 200
Walla Walla WA 99362

WITNESSES: Thomas J. Boshart
Felipe G. Hernandez



Greg E. Flowers

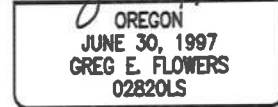

RENEWS 12/31/15

06/29/2015

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 06/06/2014

CORNER DESIGNATION: P-25, Quarter Corner for Section 24, Township 6 North, Range 37E, W.M. and P-01 , Quarter Corner for Section 19, Township 6N, Range 38E, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:

Originally surveyed by George Williams in 1872 his notes state "Set post for ¼ section corner on side hill face West from which a fir tree 10 inches in diameter, bears N. 20°W, 18 links; a fir tree 15 inches in diameter, bears N11°E, 20 links.

BLM Cadastral Surveyor Richard L. Johnson in 1991 set a stainless steel post 28 inches long 2½ inch diameter, 24 inches in the ground, with a brass cap marked ¼ S24, R37E and S19, R38E from which

A 12 inch diameter fir bears N20½°E, 24½ links distance, marked ¼ S19 BT.

A 23 inch diameter larch bears N20 ½°W, 14½ links distance.

Deposit of a white "DEEP-1" magnetic marker at base of stainless steel post.

The corner is located on E. slope, 310 links east of spur, with jeep trail, 15 links wide, bears North and South.

From this point, a point re-established as the ¼ section corner of sections 19 and 24, recorded by Wayne O. Harris, Registered Land Surveyor No. 346, in 1960, in the Umatilla County Surveyor's Office, bears N. 60° 13' 00" W., 1.115 chains distance, monumented with an iron rod, 1 inch square, firmly set, protruding 1 inch above the ground. This point is not properly positioned and is not utilized in this survey, from which a bearing tree marked by Harris:

A fir, 31 inches in diameter, bears S 2 ¼°E, 29 links distance, with a healed double blaze.

Creek, 5 links wide, course N 60°E.

Dirt road, 15 links wide, bears N. 70° E and S. 70° W.

Dry creek, 5 links wide, drains N. 65° E; asc, SE slope.

MOUNUMENT AND ACCESSORIES FOUND:

Found a 3½ BLM brass cap on a 2½ inch iron pipe .4 feet above ground on steep East slope in heavy undergrowth.

Found, a 16 inch diameter fir, with healed blaze bears N 20½°E, 16.2 feet distance, marked ¼ S19 BT.

Found a 23 inch diameter larch with tag and visible blaze and scribe, bears N20 ½°W, 9.6 feet distance.

Jeep trail found but now impassable and more of a game trail.

Found a fir tree, 31 inches in diameter, bears S 2 ¼°E, 19.1 feet distance, now dead and rotting.

MOUNUMENT MARKING DETAIL:

T6N
¼
R37E R38E
S24 S19
1991

MOUNUMENT AND ACCESSORIES SET:

A 12 inch diameter Douglas Fir blazed, scribed tagged and painted bears S22°E 29.7 feet

LOCATION AND COMMENTS:

Bearings taken with Silva hand compass and distances measured with a steel tape.