


History of original corner establishment: Corner established in 1881 by Meldrum & Campbell, under General Land Office Contract No. 380.

Surveyor General records state:

Set a pine post for cor. to secs. 3, 4, 33, 34 from which a Fir 28 in. dia. bears N45°E, 13 lks.
" 8 " " " N11°W, 57 "
" 34 " " " S33°W, 63 "
" 36 " " " S47°E, 19 "

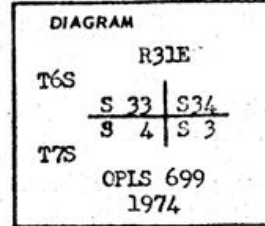

Description of corner evidence found:

Did not find the original post. Found the NW BT dead and down with obscure scribing visible. Found the NE BT as a broken oif stump about 5' high with the scribing very legible. No other evidence found.

Description of monument and accessories established to perpetuate the

original location of this corner Established the corner location using the BT evidence and info of above and set a 2"x30" galvanized pipe with a flared end and 2 1/2" brass cap 24" in the ground. Surrounded monument with a rock mound 6" high and 30" in diameter. Set a 4"x4"x6" redwood post 20" in the ground 5' West of monument with signs 54-2 & 54-4 as guard post for corner. Scalped bark and painted red band around the new Bearing Trees and posted signs 54-3 with the following information:

Down Fir	S11°E	37.6'	New BT's were scribed	
Broken Fir Stump	S45°W	8.6'	in upper blaze;	and in each
10" D. Fir	S20°E	61.1'	T6S R31E S33	lower blaze;
22" D. fir	S50°W	15.7'	T6S R31E S34	BT, along with a
20" D. fir	N14°W	108.0'	T7S R31E S3	brass nail and
10" D. fir	N86°E	40.0'	T7S R31E S4	washer stamped
				RLS 699

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Leland Lee Myers

OREGON
JULY 5, 1965
LELAND LEE MYERS
6529

I hereby certify the above corner monument was re-established as herein described on September 11, 1974.

74827

Office of *County Clerk* County of *Grant*
State of *Oregon* I hereby certify that the within instrument was filed in this office
for record on the *19* day of *Nov* 1974 at *8:30* am here *1* Page *187* Surveyor's
John Edwards by *Petty Lowrey*
(COUNTY OFFICIAL) (DEPUTY)



INDEXED

2-13