

Index File No. E-3

CORNER RECORD (SEARCH)
(Ref. FSM 7151.4)

Tract or Survey No. _____ Cor. No. _____


T 6S R. 33E

R.D. UKIAH County UMATILLA

Merid. WILLAMETTE

N.F. UMATILLA State OREGON

CORNER DIAGRAM

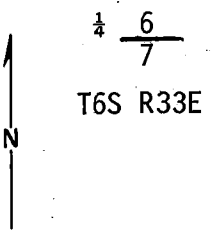

DESCRIBE CORNER MONUMENT FOUND

None

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

No evidence of the original corner or accessories was found.

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Etab. By _____
Agency

Ray J. Jangle
Signature

Title LS 1099 Division _____ Headquarters _____ Date 9-17-84 FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

At the proportionate position determined by survey between the NE corner and NW corner of Section 7, T6S R33E, we set a 2"x30" aluminum pipe, 26" in the ground, with aluminum cap attached, marked:

T6S R33E
 $\frac{1}{4}$ $\frac{S\ 6}{S\ 7}$
 PLS 1099
 1984

ACCESSORIES: DESCRIBE NEW BT'S, WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

An 8" White Fir, scribed " $\frac{1}{4}$ S6 BT" on a double blaze, bears N 18°E 28.1 feet,
 And a 12" Douglas Fir, scribed " $\frac{1}{4}$ S 7 BT" on a double blaze, bears S 72°E 19.2 feet.
 Attached brass washer, marked "LS 1099" to lower blaze of new BT's.

Work Done By: Gary Langlitz Title: LS 1099 Date: 8-84 State Registration No. or Agency: _____
 Certified Cor. Record Prepared? Yes No: Filed At: UMATILLA CO. SURVEYOR Date: 9-84

REMARKS

Corner is located 22 ft. North of an East-West fence.
 Compass Declination
 Steel Tape
 August 2, 1984

Index File No. E-3 T. 6S R. 33E M. WILLAMETTE Tract or Surv. No. _____ Cor. _____

9

10

11

12

13