


History of original corner establishment:
Frank W. Campbell under G.L.O. contract number
468, dated April 12, 1883, set a basalt stone
16"X 12"X 8" marked with 4 notches on the north
and 2 notches on the south edges, from which:

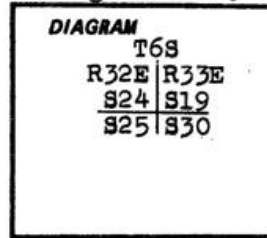

- A Tamarack, 18" dia., N35°E, 14 lks.
- A Pine, 11" dia., S65°E, 94 lks.
- A Pine, 24" dia., S15°W, 84 lks.
- A Pine, 7" dia., N10°W, 7 lks.

U.S. Cadastral Surveyors under special instructions Group Numbers 350
and 643 set the corner at record bearing and distance from an original
BT: A root hole, N10°W, 7 lks., with a down pine alongside with scribing
visible.

(Continued on Page 2 of 2.)

Description of corner evidence found:

I found a 2 1/2" iron pipe with a brass cap marked:
Corner was in a mound of stone. From the corner:

T68
R32E R33E
S24 S19
S25 S30
1968

- A Ponderosa Pine, 23" dia., N17 1/2°W, 11.9 ft.
with scribing visible.
- A Ponderosa Pine, down and badly rotted, with faint scribing
approximately 4 ft. northwesterly.
- A Ponderosa Pine, approx. 3 ft. dia., uprooted with scribing buried,
root hole S50°W, 31.7 ft.
- A Ponderosa Pine, approx. 2 1/2 ft. dia., uprooted with scribing buried,
root hole N63 1/2°E, 56.1 ft.
- A Ponderosa Pine, 17" dia., S2°E, 148.5 ft., with scribing visible.

Description of monument and accessories established to perpetuate the
original location of this corner:

I marked new BTs:

- A Ponderosa Pine, 20" dia., N21 1/2°E, 111.3 ft., marked: T68 R33E S19 BT.
- A Ponderosa Pine, 23" dia., S15°W, 94.2 ft., marked: T68 R32E S25 BT.

BTs have blaze and a 6" band painted red, a BT tag and an "Attention"
sign. New BTs have, additionally, an alum. "PLS 1832" washer nailed to
the bottom of the blaze. There is a 6' steel fence post with an
"Attention" sign within 5' of the corner.

Measured to center of BTs using steel tape and staff compass. Magnetic
declination set at 20 1/4°E.

Oct. 31, 1986

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Fayette S. Munro

OREGON
JULY 13, 1979
FAYETTE S. MUNRO
1832

Office of..... County of.....
State of..... I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY
Umatilla County Surveyor
Date 12-11-86
Rec'd By [Signature]
No. 86-137-M

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

(Continued from Page 1 of 2.)

At the corner point they set a 2 1/2" X 28" iron post with a brass cap marked: from which new BTs.

- A Pine, 24" dia., N63 1/2° E, 85 lks.
- A Pine, 31" dia., S50° W, 48 lks.
- A Pine, 23" dia., N20° W, 18 lks.
- A Pine, 15" dia., S15 1/2° E, 225 lks.

T6S
 R32E | R33E
 S24 | S19
 S25 | S30
 1968

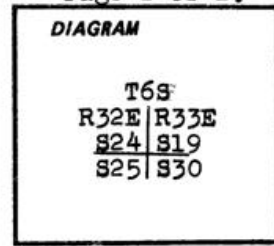

Description of corner evidence found:

Description of monument and accessories established to perpetuate the original location of this corner:



Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY
 Umatilla County Surveyor GPO-788-276
 Date _____
 Rec'd By _____
 No. 86-137-M